

Art. 932292
Smart Gas Detector
User Manual

Rev. 1 dated 08/04/2021



SERVICE

For any form of technical assistance you can contact us in one of the following ways:

telephone: +39 0521 818301
fax: +39 0521 818202
email: assistenza@mgftools.com

We will serve you as soon as possible.

The shipment of material under repair must be previously authorized by means of the RMA form (binding condition for the collection of any goods under repair).

WARRANTY TERM

The product warranty covers any manufacturing defect for a period of time equal to one (1) year from the date of manufacture for products purchased with invoice, 2 years for products purchased by private individuals.


The following clauses expressly exclude the product from guarantee:

- Consumables such as fuses, disposable battery, ..., insofar as the malfunction is caused by normal wear of the parts
- Damage caused by improper operation
- Bad maintenance
- Machine tampering or modification

The company excludes from its responsibility any indirect damage, damage caused to people and things by defects and machine downtime, incorrect use, lack of maintenance.

Overview

Smart Gas Detector (hereinafter called detector) is a new type of gas leak detector that adopts LSI technique and meets international smart technology standards. With imported high quality semi-conductor sensor and embedded microcontroller, it detects gas leakage with high sensitivity and strong adaptive ability. Being waterproof, dustproof, explosion-proof, and easy to use with high reliability, the detector is widely used in oil, coal, municipal construction, chemical engineering, environmental protection, metallurgy, refining, gas transmission and distribution, biochemistry, agriculture, pharmaceutical industries.

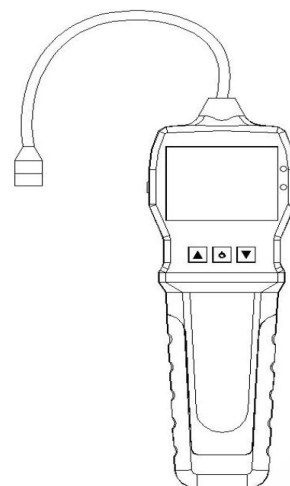

Main features and functions:

- MCU control, low consumption
- High resolution STN LCD
- Housing made of high strength engineering plastics and compound anti-slip rubber
- Detection range (low alarm point, high alarm point) adjustable
- Low battery alert, intrinsically safe design
- 3 alarm types: sound (mute mode also available), light and vibration
- Gas calibration completed by the factory
- Zero adjustment and data logging


Safety rules and precautions

 Please read this manual carefully before using this product and keep it for future reference, any deviation from the instructions may compromise the safety, quality and performance of this instrument.


Product Specifications

Specifications

Target gas	Combustible gas
Range	0-10,000ppm ($\mu\text{mol/mol}$)
Sampling method	Natural diffusion
Alarm point	Default: Low alarm: 500ppm; High alarm: 2000ppm. Support personalized setting.
Alarm types	Audible buzzer alarm; Visual LED light alarm; Vibration alarm
Warm-up time	60S
Response time	<30s
Protection level	IP65
Explosion-proof grade	Exib IIB T3 Gb
Sensor type	Imported FIGARO sensor
Sensor life	2 years
Power supply	Rechargeable lithium battery, DC3.7V 1800mAH
Charging time	6h-8h
Continuous working hours	No less than 8 hours (normal working environment)
Working condition	Temperature: $-10\sim 40^{\circ}\text{C}$ Humidity: $\leq 95\%$ RH with no condensation.
Storage condition	Temperature: $-20\sim 50^{\circ}\text{C}$ Humidity: $\leq 85\%$ RH, avoid caustic gases or substances.
Weight	Approx. 0,30 Kg (excluding accessories)
Dimension	Approx. 210(L) $\times$ 66(W) $\times$ 30(H) mm
Packing list	Detector, Carrying case, Charger, USB cable, user manual.

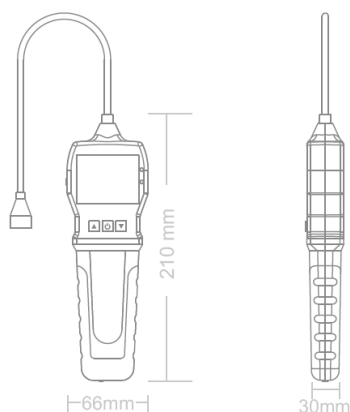

Appearance

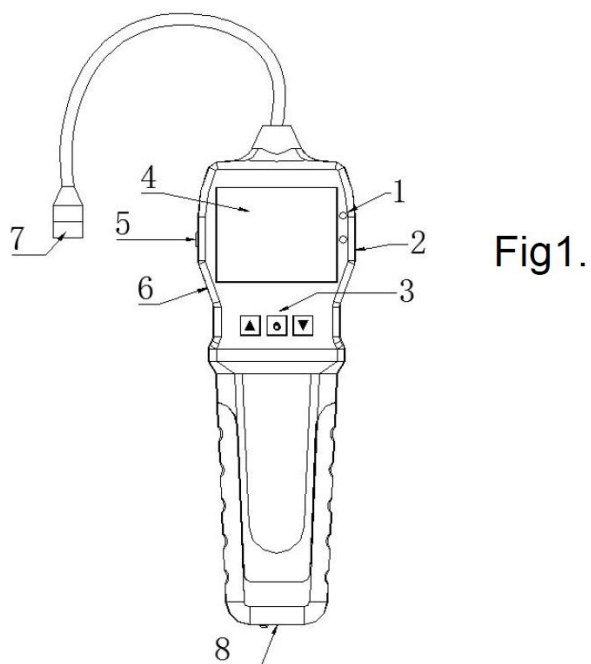

1	LED lights	5	USB Charging socket
2	Label (back)	6	Buzzer hole
3	Operation buttons	7	Gas sensor
4	LCD screen	8	External pump interface

Detector structure: the main shell, circuit boards, batteries, display, sensors, chargers.


Function instruction

Device on/off

Press the button  and then release it to turn on the detector. Press the same  button to turn it off in any case.

Every time the device is turned on, it will undergo a self-check process (see below).


Self Check

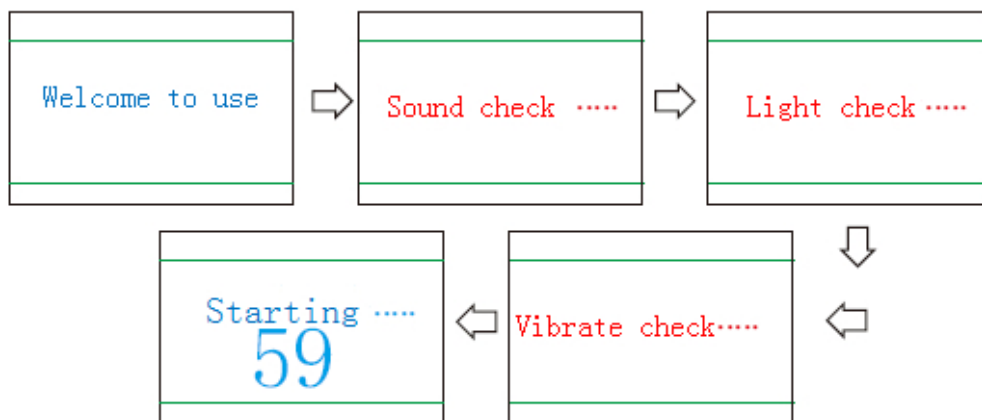

After self-check is done, the device enters into detection interface (see below).

Detection interface

Overview

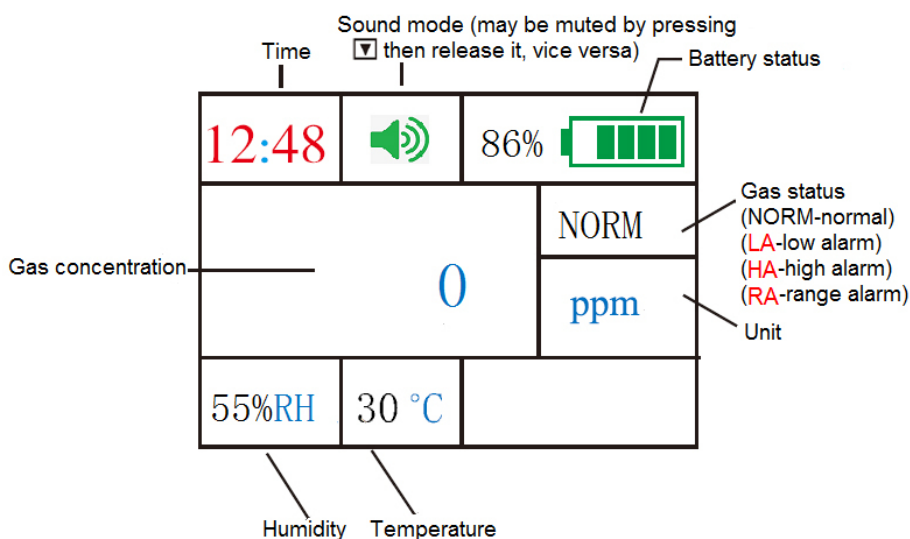

Parametric query

On the detection interface, you may press  to see all parameters.

Date: 2018.06.25	
Time: 15:45	
LA : 500 ppm	ADV :0278
HA : 2000 ppm	Volt:0.22 V
RA : 10000 ppm	BL :5MIN
BAT : 3.96V 86%	

Alarm types

- Low alarm: Red LED light + "LA" on detection interface+ slow beeping + vibration
- High alarm: Red LED light + "HA" on detection interface + fast beeping + vibration
- Range alarm: Red LED light + "RA" on detection interface + fast beeping + vibration

For personalized setting or alarm records review/deletion purpose, press on detection interface, then it will enter the function menu (see below).

Function menu

Overview

	MENU	
	1. Gas Zero	→ Zero adjustment
	2. Gas Calib	→ Gas calibration
	3. LA Set	→ Set low alarm point
	4. HA Set	→ Set high alarm point
	5. Unit set	→ Set unit(umol/mol or ppm)

	MENU	
	6. Set Time	→ Set time(year, month, date, hour, minute)
	7. Default	→ Restore factory settings
	8. AL Record	→ Check/delete alarm records
	9. ESC	→ Exit menu, back to detection interface
	10. Turn off	→ Turn off the detector

Press  or  to choose a specific function, then press  to enter.





Attention!

- About **Gas Calib**: Gas calibration is already completed by the factory, personal change may affect its normal use. If for any specific use you need to use this function, please contact the seller to get the password first.
- About **Default**: You may need to restore factory setting in case of wrong operation or gas calibration error. Please contact the seller to get the password first if it's needed.

When you see low battery alert or when the detector can't turn on because battery voltage is too low, please charge the detector in time (see below).

Charging

First, make sure the detector is off, then connect the charger to the 220V AC power source: the detector will turn on automatically, the screen will indicate "Charging". When screen displays "Full!", it means charging is completed.

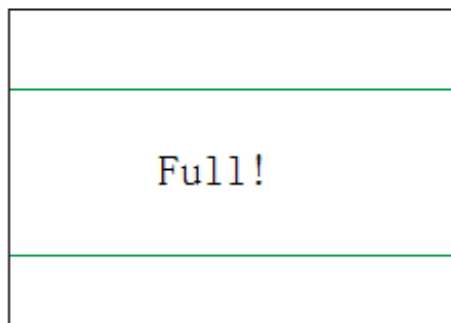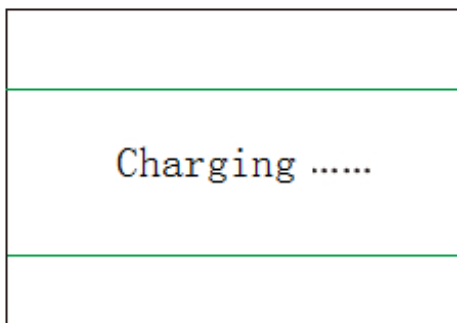

WARNING!!!

- It's impossible to turn on the detector when it's off and being charged.
- Do not charge the detector at leak detection site, to avoid fire or explosions caused by sparks introduced from plugging and unplugging the charger.
- Do not charge the detector when it's on, which may affect charging speed.

Common problems

Phenomenon	Possible Reasons	Solutions
Unable to turn on the detector	Battery voltage too low	Charge in time
Did not indicate 0	Sensor fluctuating	Zero adjustment required
Indication inaccurate	Not calibrated over long time	Gas calibration required
	Sensor fault	Contact the seller
Time inaccurate	Battery run out completely	Charge first then reset the time
	Drift in oscillator parameters	Reset the time
RA alarm in clear air	Sensor fault	Contact the seller

Notice

- Prevent the detector from falling down from high places or strenuous vibration.
- Please don't use sensor tip to touch other objects directly or block sensor tip.
- When there is interferential high-concentration gas, detector may not work normally.
- The detector will only detect gas concentration from the detection interface. So, for example, when you are on the function menu, it will not detect.
- The detector should not be stored or used where there are caustic gases (such as CL₂), or under other rigorous circumstances (including excessive high and low temperature, high humidity, electromagnetic field and strong sunlight).
- After long-term use, if there is dust on detector surface, please clean it lightly with clean soft cloth, instead of caustic solvents or hard things.
- For any operation or fault not stipulated in this manual, please contact the seller.

Conformity Declaration

MGF srl - Via Chico Mendes, 8 - 43058 Sorbolo Mezzani (PR) - Italy declares under its own responsibility that the Smart Gas Detector art. 932292 is in conformity with the following standards or standardized documents:

- EN61326-1:2013
- EN61000-4-2:2009
- EN61000-4-3:2006+A2:2010

in accordance with the regulations 2014/30/EU.

MGF srl
Fusab